




H2S-AE Hydrogen Sulfide Sensor

High Concentration



Figure 1 H2S-AE Schematic Diagram

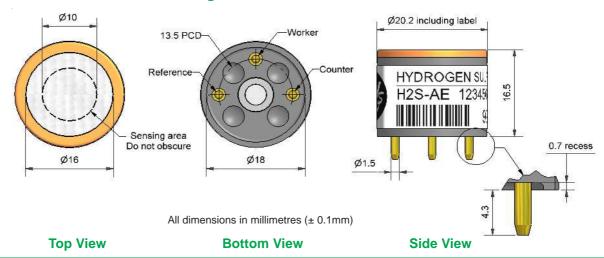

PERFORMANCE	Sensitivity	nA/ppm in 400ppm H ₂ S	65 to 125
Response time		t ₉₀ (s) from zero to 400ppm H ₂ S	< 25
	Zero current	ppm equivalent in zero air	< ±3
	Resolution	RMS noise (ppm equivalent)	< 0.5
	Range	ppm H ₂ S limit of performance warranty	2,000
	Linearity	ppm error at full scale, linear at zero and 400ppm H ₂ S	0 to -40
	Overgas limit	maximum ppm for stable response to gas pulse	10,000
LIFETIME	Zero drift	ppm equivalent change/year in lab air	nd
	Sensitivity drift	% change/year in lab air, monthly test	nd
	Operating life	months until 80% original signal (24 month warranted)	> 24

ENVIRONMENTAL

	•	% (output @ -20°C/output @ % (output @ 50°C/output @ 2 ppm equivalent change from ppm equivalent change from	20°C) @ 20ppm 20°C	80 to 92 100 to 110 < ±1 < ±1
CROSS SENSITIVITY	NO ₂ sensitivity Cl ₂ sensitivity NO sensitivity SO ₂ sensitivity CO sensitivity H ₂ sensitivity C ₂ H ₄ sensitivity NH ₃ sensitivity	% measured gas @ 10ppm % measured gas @ 10ppm % measured gas @ 50ppm % measured gas @ 20ppm % measured gas @ 400ppm % measured gas @ 400ppm % measured gas @ 400ppm % measured gas @ 20ppm	_	< -20 < -15 < 20 < 20 < 4 < 1 < 0.1 < 0.1

KEY SPECIFICATIONS

Temperature range	°C	-30 to 50
Pressure range	kPa	80 to 120
Humidity range	% rh continuous	15 to 90
Storage period	months @ 3 to 20°C (stored in sealed pot)	6
Load resistor	Ω (recommended)	10 to 47
Weight	q	< 6



At the end of the product's life, do not dispose of any electronic sensor, component or instrument in the domestic waste, but contact the instrument manufacturer, Alphasense or its distributor for disposal instructions.

NOTE: all sensors are tested at ambient environmental conditions, with 10 ohm load resistor, unless otherwise stated. As applications of use are outside our control, the information provided is given without legal responsibility. Customers should test under their own conditions, to ensure that the sensors are suitable for their own requirements.





H2S-AE Performance Data

Figure 2 Sensitivity Temperature Dependence

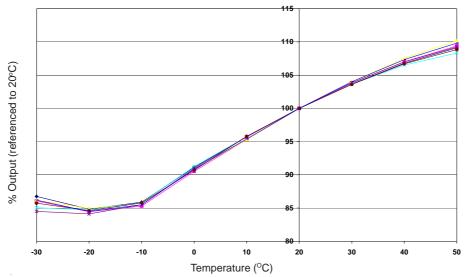


Figure 2 shows the variation of sensitivity due to changes in temperature.

This data is taken from a typical batch of sensors.

Figure 3 Zero Temperature Dependence

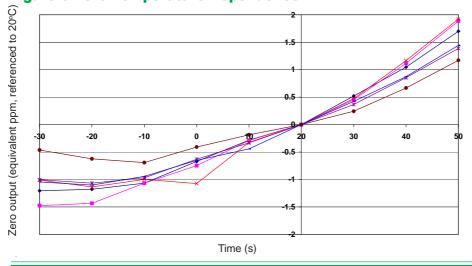


Figure 3 shows the variation in zero output caused by changes in temperature, expressed as ppm gas equivalent, referenced to zero at 20°C.

This data is taken from a typical batch of sensors.

Figure 4 Batch Repeatability

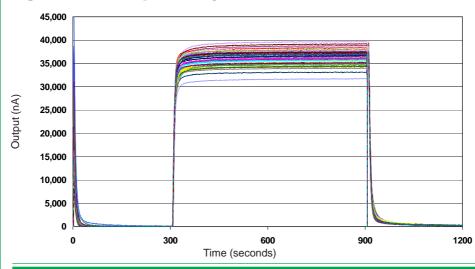


Figure 4 shows the response to 400ppm H₂S for 64 sensors. Repeatable zero, fast response and stable output are the result of good process control.

This data is taken from a typical batch of sensors.

For further information on the performance of this sensor, on other sensors in the range or any other subject, please contact Alphasense Ltd. For Application Notes visit "www.alphasense.com".

In the interest of continued product improvement, we reserve the right to change design features and specifications without prior notification. The data contained in this document is for guidance only. Alphasense Ltd accepts no liability for any consequential losses, injury or damage resulting from the use of this document or the information contained within. (©ALPHASENSE LTD) Doc. Ref. H2SAE/JUL19