

## SPECIFICATION SHEET FOR H<sub>2</sub>S SENSOR TYPE H2S/C-5000

### PERFORMANCE CHARACTERISTICS


Nominal Range	0 – 5000 ppm
Maximum Overload	10'000 ppm
Expected Operation Life	2 years in air
Output Signal	25 ± 6 nA/ppm
Resolution	5.0 ppm
Temperature Range	- 20 °C to 50 °C
Pressure Range	Atmospheric ± 10%
Pressure Coefficient	No data
T <sub>90</sub> Response Time	< 60 sec
Relative Humidity Range	15 % to 90 % R.H. non-condensing
Typical Baseline Range (pure air, 20°C)	< 40 ppm
Maximum Zero Shift (+20°C to +40°C)	40 ppm
Expected Long Term Output Drift in air	< 2% signal loss/month
Recommended Load Resistor	10 Ohm
Bias Voltage	Not recommended
Repeatability	< 2 % of signal
Output Linearity	Linear

### PHYSICAL CHARACTERISTICS


Weight	~ 13 g
Position Sensitivity	None
Storage Life	12 months in container
Recommended Storage Temperature	5 °C – 20 °C
Warranty Period	12 months from date of dispatch

### Compact-Size Outline Dimensions

#### BOTTOM VIEW

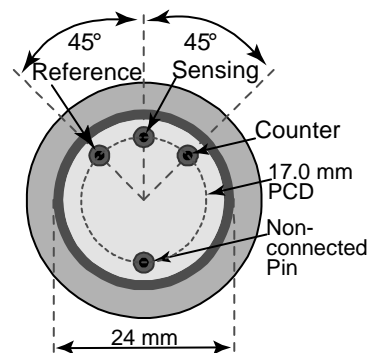

#### SIDE VIEW

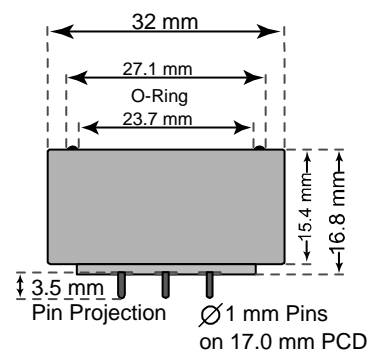

### CROSS-SENSITIVITY DATA

Interfering Gas	Concentration	Reading
H <sub>2</sub>	12'000 ppm	< 100 ppm
CO	500 ppm	< 10 ppm
SO <sub>2</sub>	500 ppm	~ 100 ppm
NO	350 ppm	< 20 ppm
NO <sub>2</sub>	50 ppm	~ - 10 ppm
HCl	25 ppm	0 ppm
NH <sub>3</sub>	50 ppm	0 ppm
CO <sub>2</sub>	50 %	0 ppm

Performance data conditions:  
20 °C, 50% RH and 1013 mbar

### APPLICATIONS


Safety and Environmental Control  
For high H<sub>2</sub>S-concentrations in discontinuous mode

## SPECIFICATION SHEET FOR H<sub>2</sub>S SENSOR TYPE H2S/C-5000


### TEMPERATURE DEPENDENCE

The output of an electrochemical sensor varies with temperature. The graphs below show the variation in output with temperature for this type of sensor. The results are shown in the graphs as a mean for a batch of sensors, along with confidence intervals corresponding to  $\pm 3$  times the standard deviation. The sensitivity dependence is expressed as a percentage of the signal at 20 °C. The shift in baseline is shown in ppm referenced to 20 °C.

#### Sensitivity Temperature Dependence

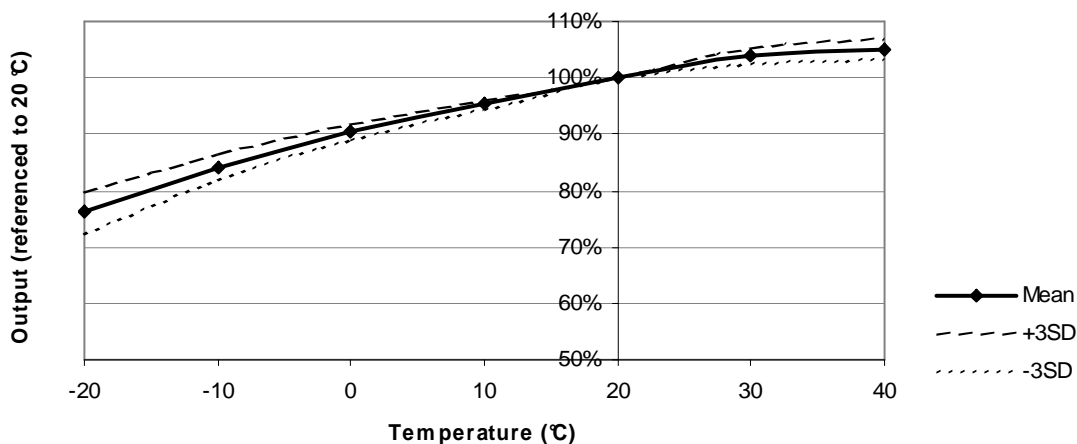

#### Baseline Temperature Dependence

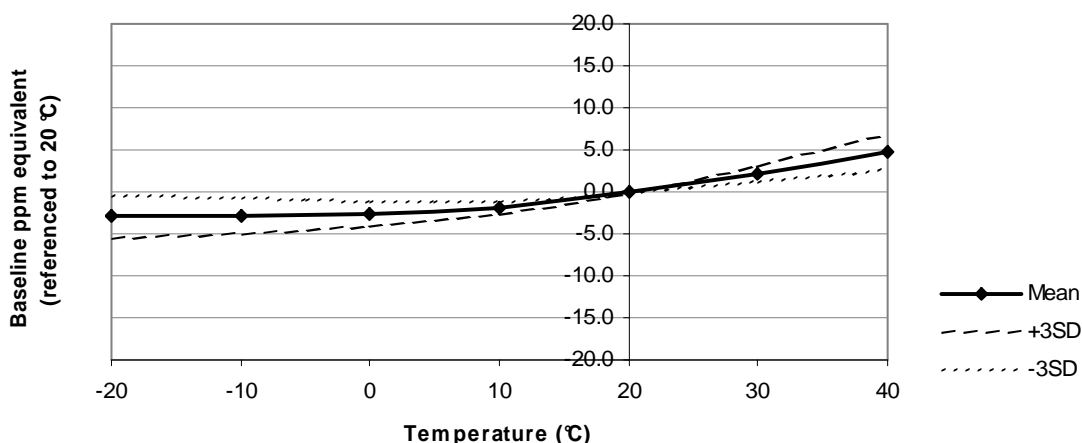

The data contained in this document is for guidance only. Membrapor AG accepts no liability for any consequential losses, injury or damage resulting from the use of this document or the information contained within it. The data is given for guidance only. Customers should test under their own conditions, to ensure that the sensors are suitable for their own requirements.