SPECIFICATION SHEET FOR HIGH SENSITIVE NO SENSOR TYPE NO/S-25-S

PERFORMANCE CHARACTERISTICS

Nominal Range	0 – 25 ppm	
Maximum Overload	50 ppm	
Expected Operation Life	3 years in air	
Output Signal	2000 ± 400 nA/ppm	
Resolution	0.05 ppm	
Temperature Range	- 20 °C to 45 °C	
Pressure Range	Atmospheric ± 10%	
Pressure Coefficient	No data	
T ₉₀ Response Time	< 10 sec	
Relative Humidity Range	15 % to 90 % R.H.	
	non-condensing	
Typical Baseline Range (pure	+ 0.25 to + 1 ppm	
air, 20°C)		
Maximum Zero Shift (+20°C	3 ppm	
to +40°C)		
Long Term Output Drift	< 2% signal loss/month	
Recommended Load Resistor	10 Ohm	
Bias Voltage	+ 300 mV	
Repeatability	< 2 % of signal	
Output Linearity	Linear	

CROSS-SENSITIVITY DATA

Interfering Gas	Concentration	Reading
CO	300 ppm	0 ppm
SO ₂	5 ppm	0 ppm
H₂S	15 ppm	< 5 ppm
NO ₂	10 ppm	< 3 ppm
H ₂	300 ppm	0 ppm

Performance data conditions: 20 °C, 50% RH and 1013 mbar


APPLICATIONS


Continuous Air Quality Monitoring Safety and Environmental Control

PHYSICAL CHARACTERISTICS

Weight	~ 27 g
Position Sensitivity	None
Storage Life	Six months in
	container
Recommended Storage	5 °C – 20 °C
Temperature	
Warranty Period	12 months from date
	of dispatch

Slim-Size Outline Dimensions

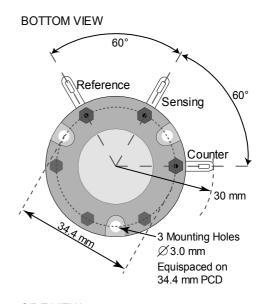

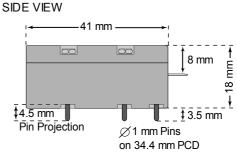

REV.: 12/2014 Page 1 of 2


Phone: +41 43 311 72 00 Fax: +41 43 311 72 01 Email: info@membrapor.ch www.membrapor.ch




SPECIFICATION SHEET FOR HIGH SENSITIVE NO SENSOR TYPE NO/S-25

TEMPERATURE DEPENDENCE

The output of an electrochemical sensor varies with temperature. The graphs below show the variation in output with temperature for this type of sensor. The results are shown in the graphs as a mean for a batch of sensors, along with confidence intervals corresponding to ±3 times the standard deviation. The sensitivity dependence is expressed as a percentage of the signal at 20 °C. The shift in baseline is shown in ppm referenced to 20 °C.

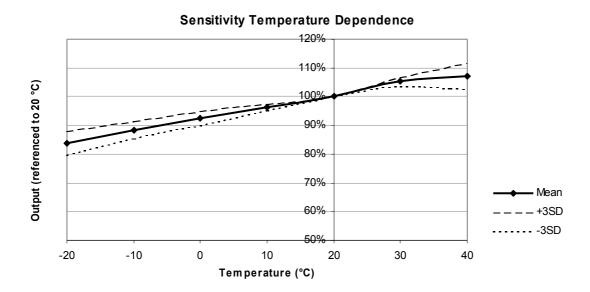

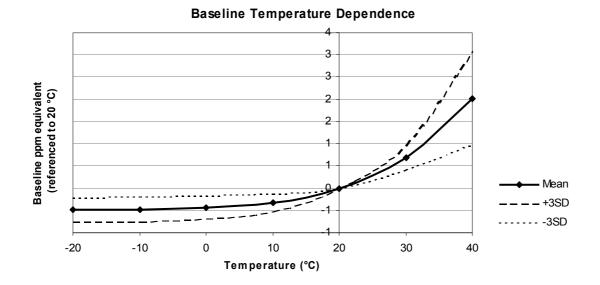

The data contained in this document is for guidance only. Membrapor AG accepts no liability for any consequential losses, injury or damage resulting from the use of this document or the information contained within it. The data is given for guidance only. Customers should test under their own conditions, to ensure that the sensors are suitable for their own requirements.

REV.: 12/2014 Page 2 of 2

Phone: +41 43 311 72 00 Fax: +41 43 311 72 01 Email: info@membrapor.ch www.membrapor.ch MEMBRAPOR AG Birkenweg 2 CH-8304 Wallisellen Switzerland